



Remove your work piece from the lathe while still attached to the face plate.

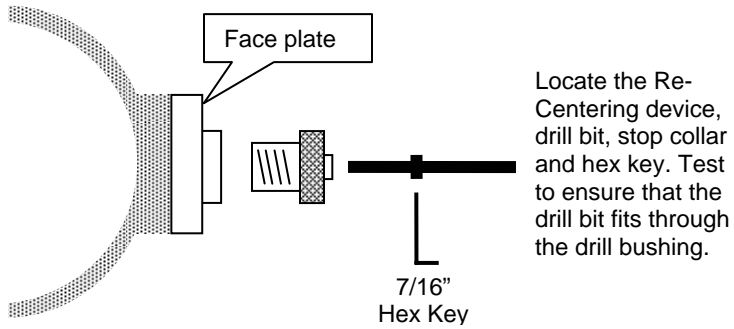


Thread the Re-Centering device into the faceplate. Slide the drill bit through the drill bushing until it bottoms out against the waste stock. Set the stop collar so that ~5/16" gap remains. Tighten securely!

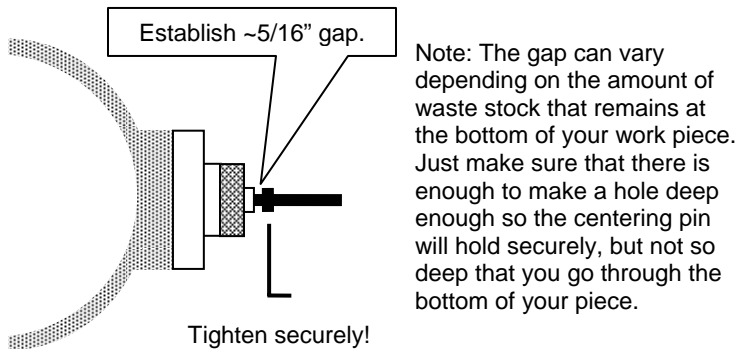


Chuck the drill bit into a power drill and drill to depth.

Unscrew the Re-Centering device from the faceplate. Inspect the hole that you drilled to see if it is deep enough. Once you are satisfied with the results, remove the face plate

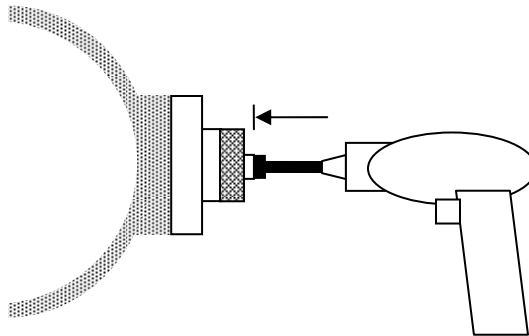

Position the work piece against a jam chuck or vacuum chuck. Slide the tail stock forward until the centering pin goes into the previously drilled hole. Secure the tail stock. Advance the tail stock quill until enough pressure is applied to hold the work piece into place.

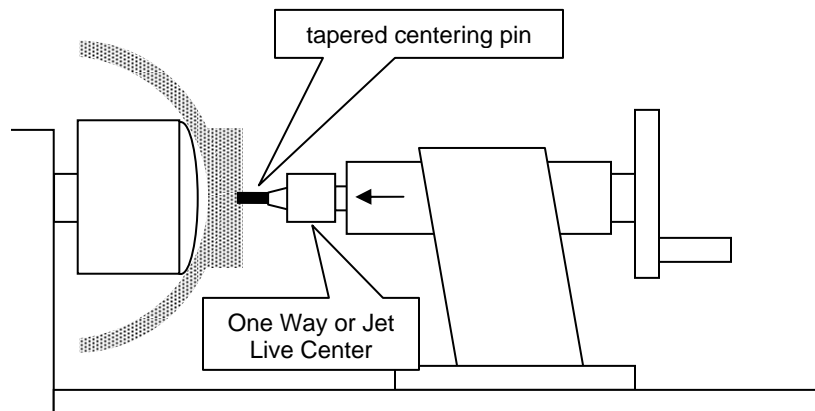

Using *Geiger's* Re-Centering Solution with a face plate.

Geitech, Inc. 2606 NW 170th Street, Newberry, FL 32669, 352-472-5035,
www.geigerssolutions.com